» FTA54+

Outdoor sensor for relative humidity and temperature



Datasheet

Subject to technical alteration Issue date: 08/14/2020 • A110



» APPLICATION

Sensor for measuring humidity and temperature in outdoor areas. In delivery condition, the sensor is designed for measuring temperature and relative humidity. Alternatively the output can be set to absolute humidity, enthalpy or dew point. A mounting base for mounting on a level surface and fixing material are included in delivery.

»TYPES AVAILABLE

Outdoor humidity sensor temperature + humidity - active 2x 0..10 V | 4..20 mA

FTA54+ VV FTA54+ AA

Options: Additional passive temperature sensor (type VVS|AAS) eg: PT100/PT1000/NI1000/NI1000TK5000/NTC10K... and other sensors on request.

» SECURITY ADVICE - CAUTION



The installation and assembly of the device should only be performed by authorized personnel.

The product should only be used for the intended application. Unauthorized modifications are prohibited! The product must not be used in relation with any equipment that in case of a failure may threaten, directly or indirectly, human health or life or result in danger to human beings, animals or assets. Ensure all power is disconnected before installing. Do not connect to live/operating equipment.

Please comply with

- Local laws, health & safety regulations, technical standards and regulations
- Condition of the device at the time of installation, to ensure safe installation
- This data sheet and installation manual

Page 2 / 5 Issue Date: 14.08.2020

» NOTES ON DISPOSAL



As a component of a large-scale fixed installation, Thermokon products are intended to be used permanently as part of a building or a structure at a pre-defined and dedicated location, hence the Waste Electrical and Electronic Act (WEEE) is not applicable. However, most of the products may contain valuable materials that should be recycled and not disposed of as domestic waste. Please note the relevant regulations for local disposal.

» BUILD-UP OF SELF-HEATING BY ELECTRICAL DISSIPATIVE POWER

Temperature sensors with electronic components always have a dissipative power, which affects the temperature measurement of the ambient air. The dissipation in active temperature sensors shows a linear increase with rising operating voltage. This dissipative power has to be considered when measuring temperature. In case of a fixed operating voltage (± 0.2 V) this is normally done by adding or reducing a constant offset value. As Thermokon transducers work with a variable operating voltage, only one operating voltage can be taken into consideration, for reasons of production engineering. Transducers 0..10 V / 4..20 mA have a standard setting at an operating voltage of 24 V =. That means, that at this voltage, the expected measuring error of the output signal will be the least. For other operating voltages, the offset error will be increased by a changing power loss of the sensor electronics. If a re-calibration should become necessary later directly on the sensor, this can be done by means of a trimming potentiometer on the sensor board.

Remark: Occurring draft leads to a better carrying-off of dissipative power at the sensor. Thus temporally limited fluctuations might occur upon temperature measurement.

» APPLICATION NOTICE FOR HUMIDITY SENSORS

Refrain from touching the sensitive humidity sensor/element. Touching the sensitive surface will void warranty.

For standard environmental conditions re-calibration is recommended once a year to maintain the specified accuracy. When exposed to high ambient temperature and/or high levels of humidity or presence of aggressive gases (i.e. chlorine, ozone, ammonia) the sensor element may be affected and re-calibration may be required sooner than specified. Re-calibration and deterioration of the humidity sensor due to environmental conditions are not subject of the general warranty.

» PRODUCT TESTING AND CERTIFICATION



Declaration of conformity

The declaration of conformity of the products can be found on our website https://www.thermokon.de/.

» USE ENCLOSURE WITH UV AND WEATHER RESISTANCE

After some time, outdoor mounted plastics can lose their color and quality. Therefore, all USE housings are made of special white polycarbonate (PC). The light-stable colorants and additives are used to achieve optimum protection of the polymer while maintaining color stability. The titanium dioxide used is specially developed for polycarbonate and offers excellent UV protection through the reflection of the entire light spectrum including the UV component by 340 nm. This effectively counteracts the otherwise occurring photochemical polymer degradation. The colors stay full for a long time without fading. The material is also resistant to cold and frost.

» APPLICATION NOTICE

After a certain time, dirt in the air can collect on the filter and then adversely affect the operation of the sensor. Under normal ambient condition an annual maintenance is recommended. Rinse the filter after cleaning with distilled water and dry it using clean oil-free air or nitrogen. Extremely contaminated filters should be replaced. At extreme ambient conditions, e.g. corrosive gases, the humidity sensor may have to be changed.


Issue Date: 14.08.2020 Page 3 / 5

»TECHNICAL DATA

Measuring values	temperature, humidity (humidity output configurable)			
Output voltage	VV 2x 010 V or 05 V, configurable via Jumper, min. load 10 kΩ			
Output ampere	AA 2x 420 mA, max. load 500 Ω			
Output passive	VVS AAS optional, PT100/PT1000/NI1000/NI1000TK5000/NTC10K and other sensors on request			
Power supply	VV 1524 V = (±10%) or 24 V ~ (±10%) SELV		AA 1524 V = (±10%) SELV	
Power consumption	vv typ. 0,4 W (24 V =) 0,8 VA (24 V ~)		AA typ. 1 W (24 V =)	
Measuring range temp.	VV AA adjustable at the transducer: 0+200 +40+140 -40+160 0+100 °F, default setting: 0+200 °F		passive -4+158 °F	
Measuring range humidity	rel. humidity 0100% rH non- condensing	abs. humidity 050 080 g/m³, default: 050 g/m³	enthalpy 085 KJ/kg	dew point +40+140 0+200 °F, default: +40+140 °F
Accuracy temperature	VV AA ±0,3 K (typ. at 70 °F within default measuring range)		passive typ. ±0,3 K (typ. at 70 °F), depending on used sensor	
Accuracy humidity	±2% between 1090% rH (typ. at 70 °F)			
Enclosure	enclosure USE-M, PC, pure white, UV resistant			
Protection	IP65 according to EN 60529			
Cable entry	Flextherm M20, for wire max. Ø=0.180.35 in., removable			
Connection electrical	removable plug-in terminal, max. 14AWG			
Filter	stainless steel wire mesh			
Ambient condition	-4+158 °F, short term condensation			

» MOUNTING ADVICES

In case of outdoor installation avoid direct rain and sun contact. Probably use sun respectively rain protection. Cable entry from bottom or side. For side cable routing set loop so that precipitation can drain defined. Observe permissible ambient condition.

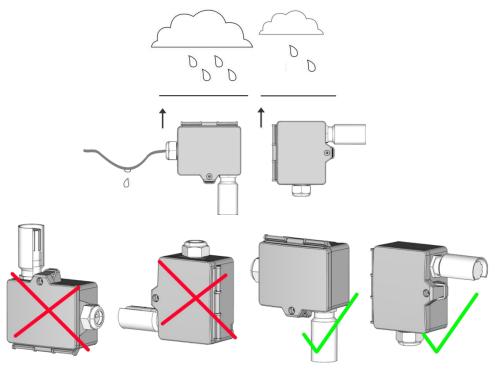

Page 4 / 5 Issue Date: 14.08.2020

» CONNECTION PLAN


Clamp ST+ | ST- : passive Sensor (VVS | AAS)

AOI1 | AOU1: Humidity AOI2 | AOU2: Temperature

The adjustment of the measuring ranges is made by changing the jumpers in a de-energized state. The output value of the new measuring range is available after 2 seconds. fig. (Measuring range and offset adjustment, default settings: 0 °F..+200 °F | 0 °F)


Note (type FTA54+ AA)

When only using the temperature output, the humidity output must always be connected to mass/GND of the analog input module.

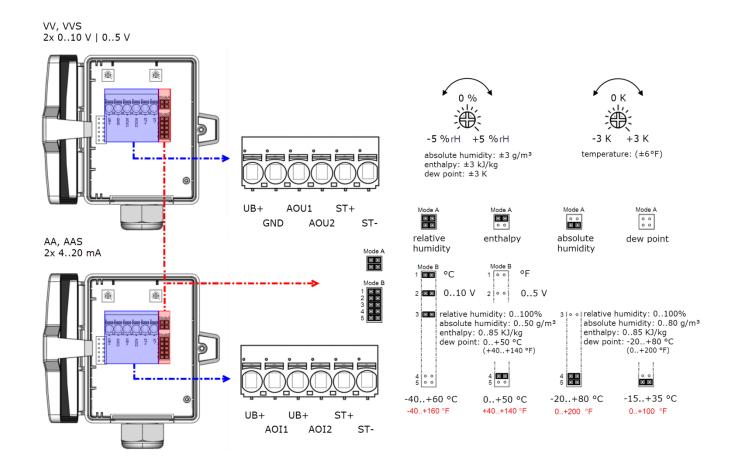

Issue Date: 14.08.2020 Page 5 / 5

» DIMENSIONS (IN.)

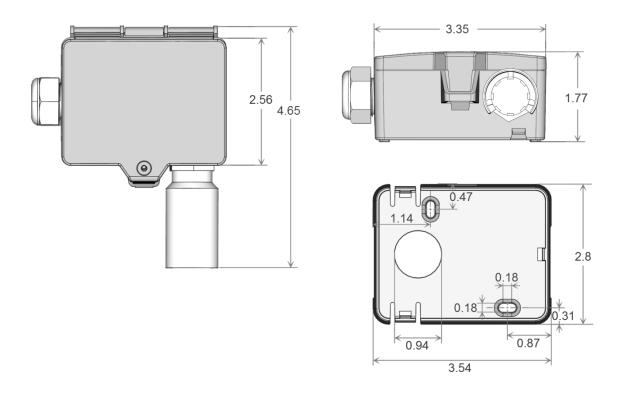

» ACCESSORIES (INCLUDED IN DELIVERY)

Rain protection Mounting base Mounting kit universal

• Cover screw + screw cover• 2 Rawlplugs • 2 Screws (countersunk head) • 2 Screws (rounded head)

Item No. 670715 Item No. 631228 Item No. 698511

» ACCESSORIES (OPTIONAL)

Cable entry M25 USE white, sealing insert 4x \emptyset =0.28 in. (4 pcs) Filter stainless steel, wire mesh Sealing insert M20 USE white, 2x \emptyset =0.28 in. (for 2 wire; PU 10 pieces)

Item No. 641364 Item No. 231169 Item No. 641333